



Cowlitz County Health & Human Services Department

Environmental Health Unit
207 Fourth Avenue North, Kelso, WA 98626
TEL (360) 414-5599 FAX (360) 425-7531
www.co.cowlitz.wa.us/hhs

SOILS EVALUATION CHECKLIST

Project Address (if available): 1819 Spirit Lake Hwy Parcel No.: WF0620004

Plat #: _____ Lot #: 4 of 4 Acreage 2.36 Method II Analysis Required (Indicate One): Yes No

Name: Salty J LLC Choose one: Owner Applicant Authorized Agent

Designer: Travis Buck #Bedrooms/GPD: 3/360 Water Supply: Public Well (choose one)

Proposed System Type: Standard Gravity Flow

Proposed Treatment Level (choose one): A B C D E N

DESIGNER INITIAL		STAFF INITIAL
TB	1. Completed EHU Master Application*, including parcel # and address (if available)	
TB	2. A Cowlitz County Planning Certification form had been completed (please circle: YES or NO)	
TB	3. Name & Address of property owner and applicant on each page of submission. [WAC 246-272A-0200(1)(a)(i)]	
TB	4. Each page of submission is stamped, signed, and dated by a Washington State Professional	
TB	Engineer or Onsite Wastewater Designer (RCW 18.210.130, WAC 196-33-500)	
	(The Soil Log/Evaluation Report may be completed by a soil scientist)	
TB	5. A site plan is attached and shows general topography and /or slope are shown on the parcel for	
TB	the applicable areas	
TB	6. Site plan shows test-hole locations, primary and reserve drainfield areas, and the well or proposed	
TB	well location with 100' radius around the well or proposed well.	
TB	7. Numbered Soil Log/Evaluation Report dated and attached with texture, structure, and other soil	
TB	characteristics.	
TB	8. The site is ready for inspection:	
	<ul style="list-style-type: none"> <li data-bbox="331 1243 1365 1271">Clear and concise directions to inspection site are provided (if necessary). 	
	<ul style="list-style-type: none"> <li data-bbox="331 1271 1365 1300">Entrance to property is clearly marked 	
	<ul style="list-style-type: none"> <li data-bbox="331 1300 1365 1328">Primary and reserve areas are labeled** 	
TB	<ul style="list-style-type: none"> <li data-bbox="331 1328 1365 1355">Test pits are open and labeled with at least two soil logs within / immediately adjacent to 	
	<ul style="list-style-type: none"> <li data-bbox="331 1355 1365 1383">the primary and reserve area; test pits match the soil log 	N/A

Comments: _____

Permit Number (For official use)

* Not required for online application.
** If the site is constricted and horizontal setback are in question, we reserve the right to have the designer re-stake the area.

For more information, contact OMseptic@co.cowlitz.wa.us. Permit intake and issuance hours are Monday through Thursday, 7:30 am – 5:30 pm.

Last Date Revised: 04/23/2021

EHU Form: 8432



Advanced Septic Consulting Inc.

Site Evaluation & Soil Report for Lot 4 @ 1819 Spirit Lake Hwy.

November 4, 2024

Design Number: 24-238.4



Customer: Salty J LLC, 1550 Butte Hill Rd. Woodland, Washington 98674

Project Location: 1819 Spirit Lake Hwy. Castle Rock, Washington 98611

Section: 6 Township: 9N Range: 1W Lot: 4 of 4

Parcel Number: WF0620004 Acres: 2.36 No. Bedrooms: 3

Type of Water Supply: Public Water

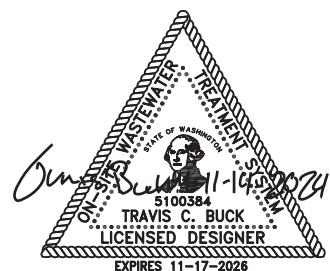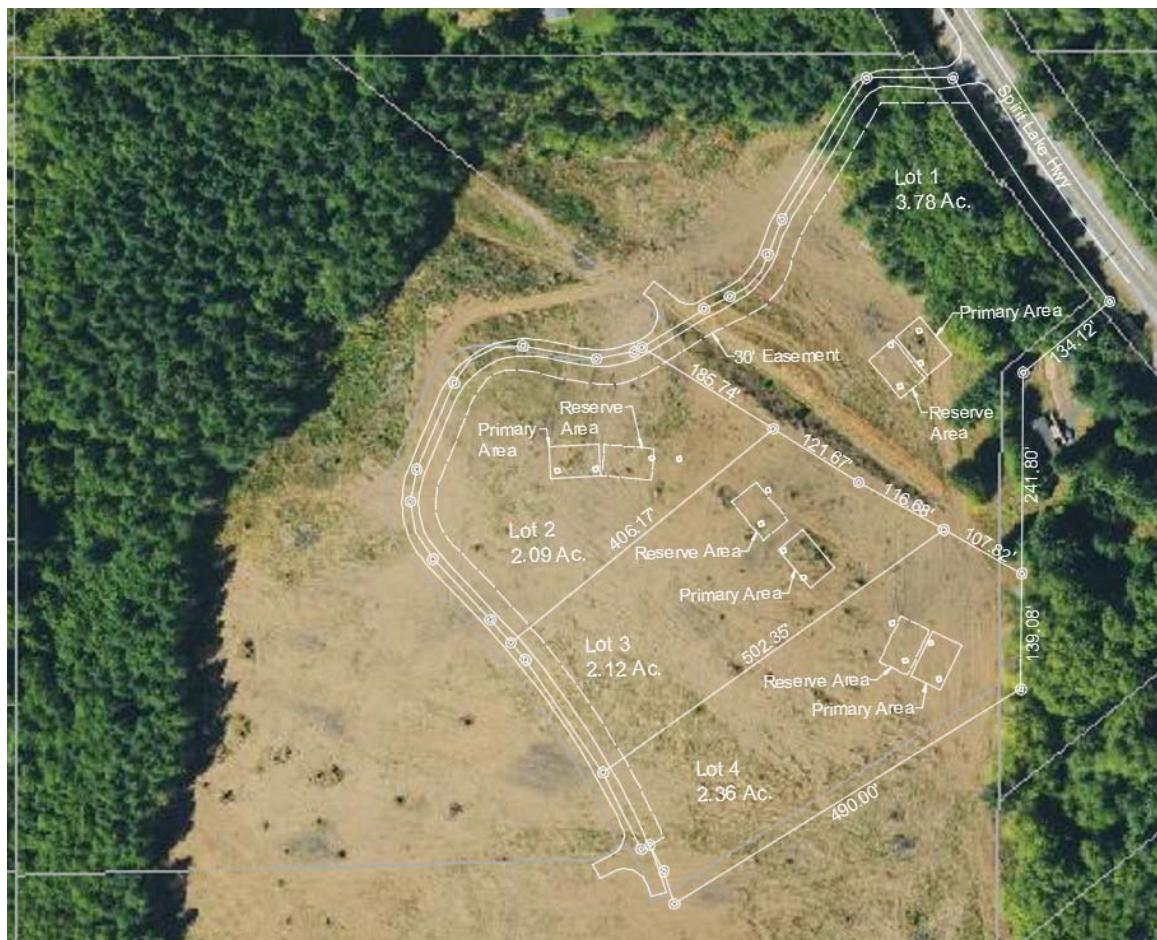



Advanced Septic Consulting Inc.

November 4, 2024

Design Number: 24-238.4

Customer: Salty J LLC, 1550 Butte Hill Rd. Woodland, Washington 98674

Project Location: 1819 Spirit Lake Hwy. Castle Rock, Washington 98611

Section: 6 Township: 9N Range: 1W Lot: 4 of 4

Parcel Number: WF0620004 Acres: 2.36 No. Bedrooms: 3

Type of Water Supply: Public Water

Site Characteristics:

The site is located within USDA-NRCS mapping unit 148 – Olympic Silt Loam. Typical water table is greater than 80". The site is well drained in the primary septic area with no mottling or restrictive layer noted to 55". The reserve area has moderate mottling and a restrictive layer noted at 44". Typical slope ranges from 20 to 30%. The proposed primary septic area is on an east facing slope with a slope ranging from 8 to 12%. Vegetation in the septic area has mostly been cleared by recent land clearing activities.

Soil Evaluation:

	<u>Depth</u>	<u>Soil</u>	<u>Type</u>	<u>Structure</u>	<u>Color</u>	<u>Roots</u>	<u>Mottling</u>
Test Hole #1	0-10"	SiL	5	3, m, gr	10yr5/3	m/f	None
	10-55"	siCL	5	2, m, sbk	10yr4/4	f/f	None
Test Hole #2	0-12"	SiL	5	3, m, gr	10yr5/3	m/f	None
	12-55"	siCL	5	2, m, sbk	10yr4/4	f/f	None
Test Hole #3	0-17"	SiL	5	3, m, gr	10yr5/3	m/f	None
	17-44"	siCL	5	2, m, sbk	10yr4/4	f/f	None
	44-45"	siCL	7	1, m, sbk	Mixed	None	Moderate
Test Hole #4	0-8"	SiL	5	3, m, gr	10yr5/3	m/f	None
	8-51"	siCL	5	2, m, sbk	10yr4/4	f/f	None


Design Requirements:

Based upon the evaluation performed on October 8, 2024 it is my determination that the primary area is adequate for the use of a Standard Gravity Flow system meeting Treatment Level E to service the on-site septic needs of the future home.

The primary area will require 900 sq. ft. of drain field and 2,250 sq. ft. of land area.



The reserve area has been designated for the use of a Standard Pressure Distribution system meeting Treatment Level E and will require 900 sq. ft. of drain field and 2,250 sq. ft. of land area.

Other comments or concerns:

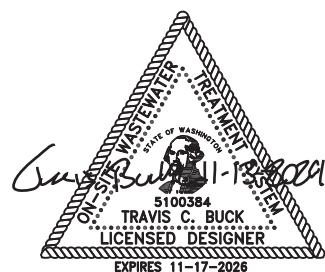



160'
80'
0'

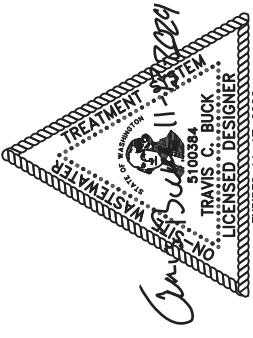
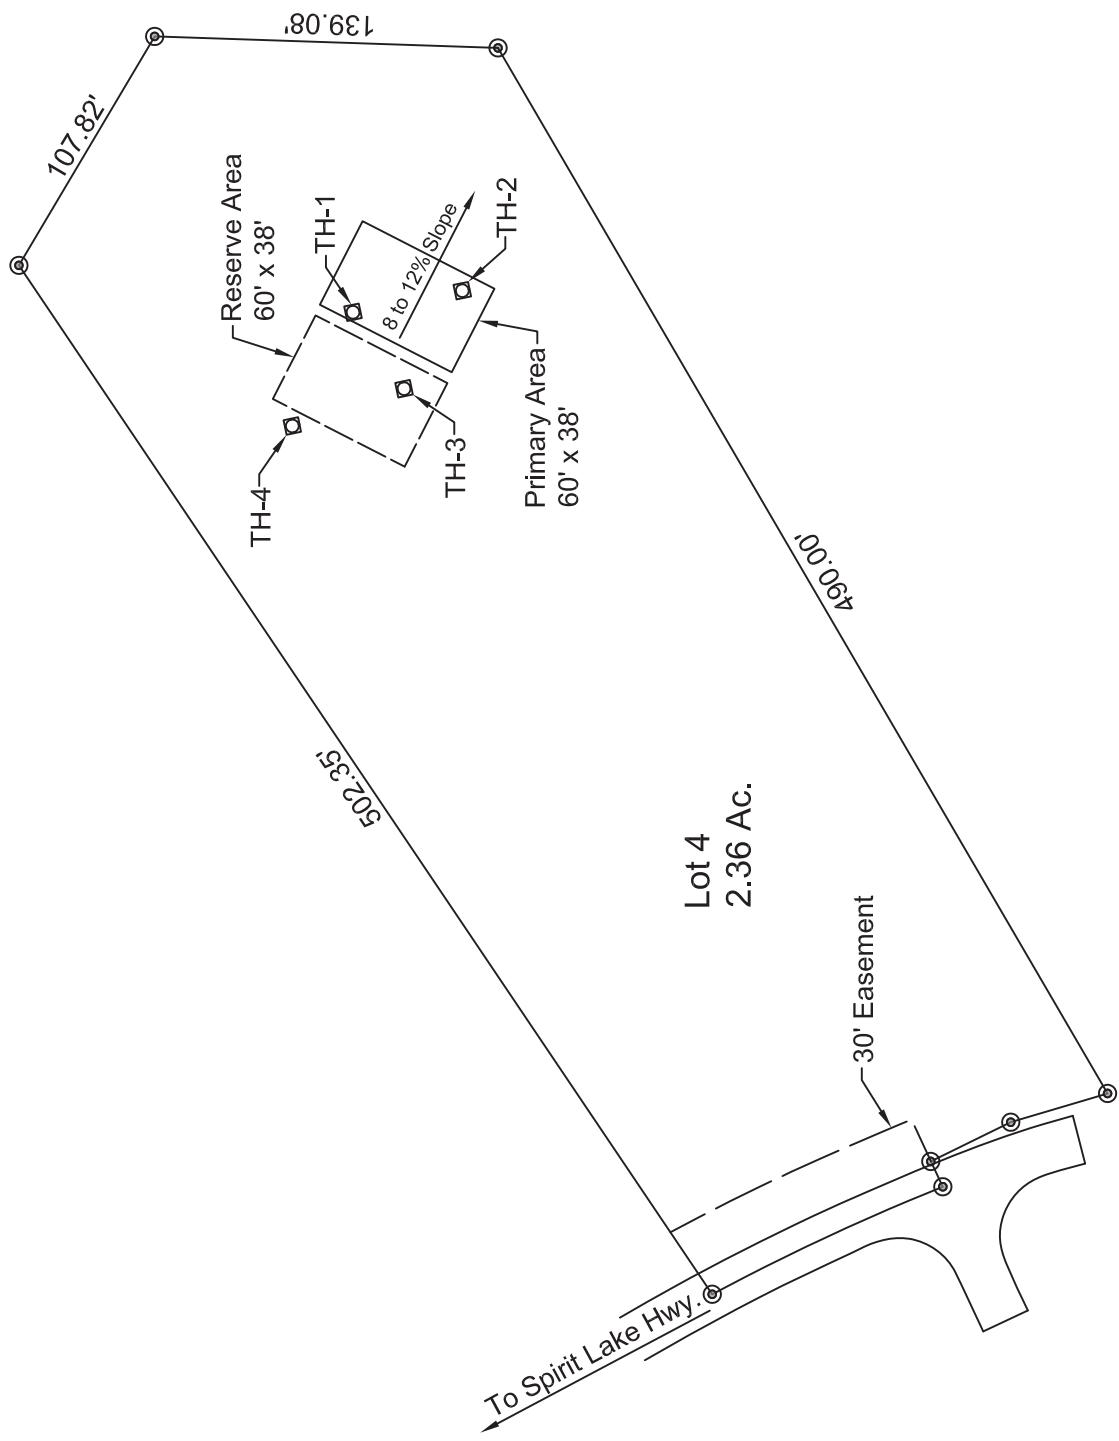


EXPIRES 11-17-2026

Salty J LLC	Advanced Septic Consulting Inc.	Design: 24-238.4	Date: 11/4/2024
1819 Spirit Lake Hwy. Castle Rock, Washington 98611	3210 Westside Hwy. Castle Rock, Washington 98611 Cell: 360-433-5476 E-Mail: dirtwhisperer@gmail.com	Drawing: 1	Scale: 1" = 80'

Advanced Septic Consulting Inc.
3210 Westside Hwy. Castle Rock, Washington 98611
Cell: 360-433-5476 E-Mail: dirtwhisperer@gmail.com

Salty J LLC
1819 Spirit Lake Hwy.
Castle Rock, Washington 98611

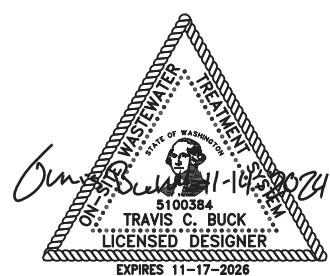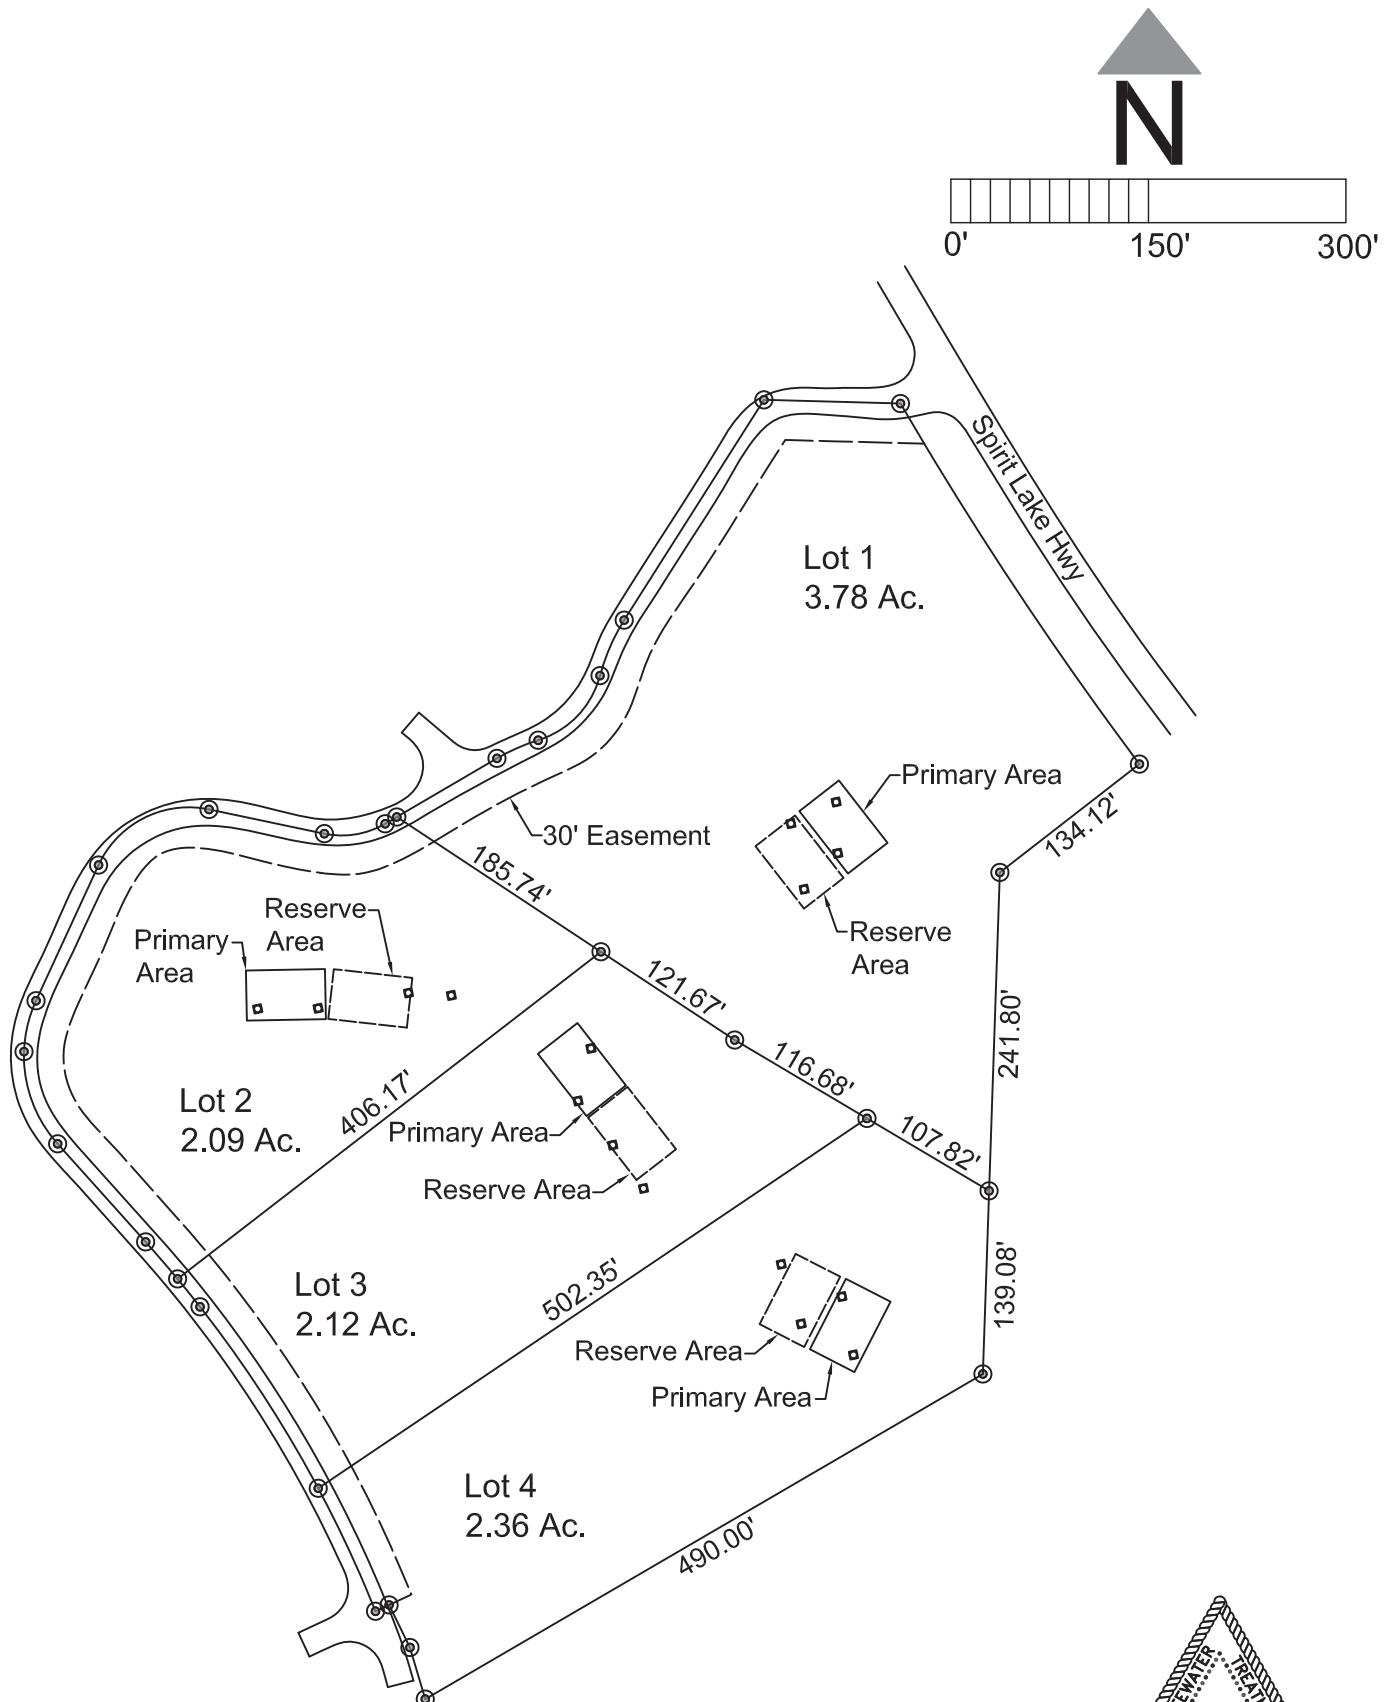

Salty J LLC
1819 Spirit Lake Hwy.
Castle Rock, Washington 98611

Advanced Septic Consulting Inc.
3210 Westside Hwy. Castle Rock, Washington 98611
Cell: 360-433-5476 E-Mail: dirtwhisperer@gmail.com

Design:
24-238

Date:
11/14/2024

Drawing: 2

Scale: 1" = 150'